

Access
the
inaccessible®

PROFESSIONAL

SPORT

HÄNDLER

KUNDENSERVICE

DOWNLOADS



VERTIKALE AKTIVITÄTEN

BELEUCHTUNG

TECHNISCHE RATSCHLÄGE

GEMEINSCHAFT

SICHERHEITSWARNUNGEN

Suche

AUFRUF ZUR KONTROLLE DER ASTRO UND CANYON GUIDE GURTE

Request for inspection of ASTRO and CANYON GUIDE harnesses following the detection of a defect on the gated opening attachment point of an ASTRO harness. Due to the risk of unintentional opening of this attachment point, which could result in a life-threatening situation, we ask you to stop any use of these harnesses and to carry out immediately the following inspection.

25 OKTOBER 2023 LAUFENDE AKTIONEN



ASTRO BOD FAST



ASTRO SIT FAST






CANYON GUIDE

References concerned by this request for inspection

Suchen




Product name	Picture	References	Serial numbers concerned
ASTRO BOD FAST european version		C083AA00 C083AA01 C083AA02	All serial numbers up to 23J 0000000 000 included
ASTRO BOD FAST international version		C083BA00 C083BA01 C083BA02 C083BA03 C083BA04 C083BA05	All serial numbers up to 23J 0000000 000 included
ASTRO SIT FAST		C085AA00 C085AA01 C085AA02	All serial numbers up to 23J 0000000 000 included
CANYON GUIDE		C086BA00 C086BA01	All serial numbers up to 23J 0000000 000 included


Origin and consequences of the defect

Suchen



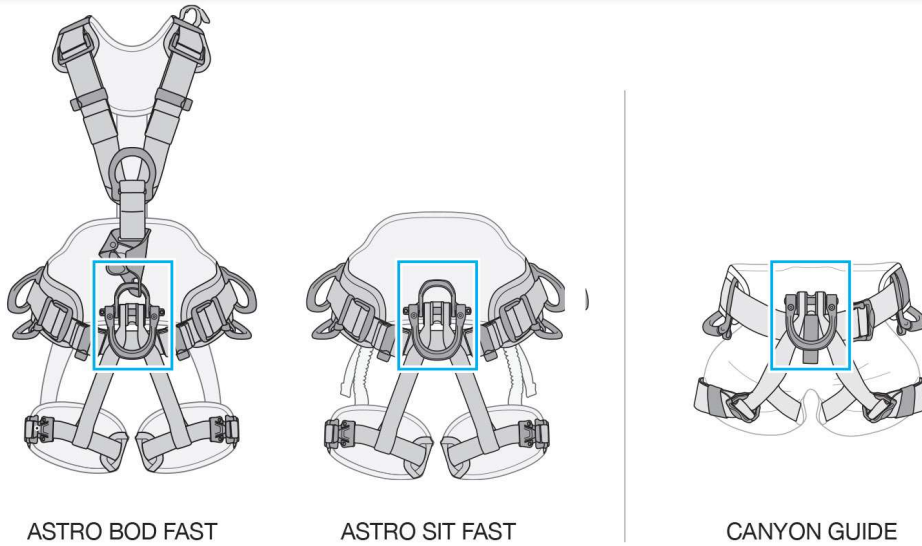

Bill of material of the gated ventral attachment point:

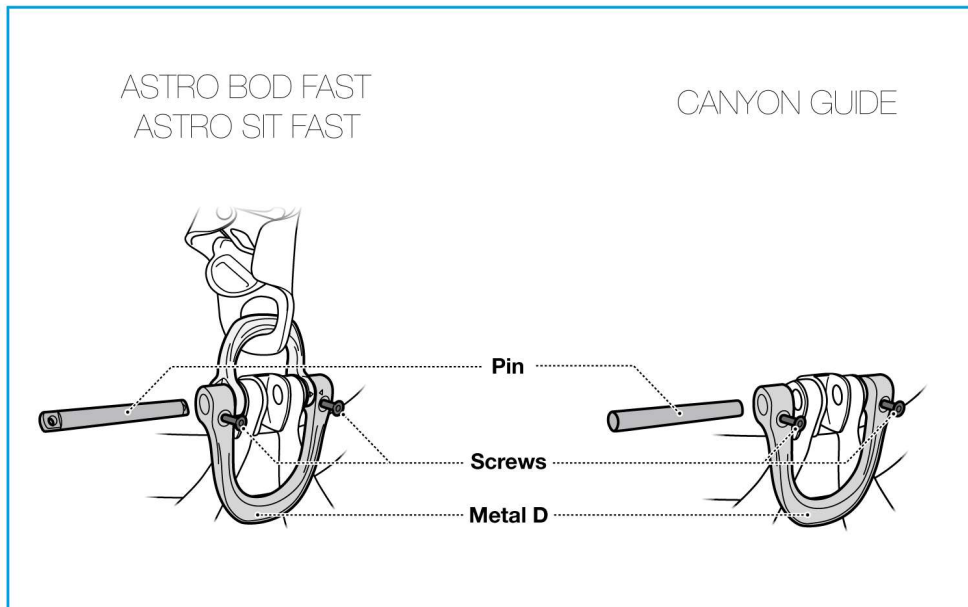

The defect is due to a poor machining process of the metal D. This can cause the pin to slide completely sideways, despite the presence of the 2 screws. This situation presents a risk of death due to strangulation or falling from a height.

Inspection procedure



ASTRO BOD FAST ASTRO SIT FAST	CANYON GUIDE
1) Prepare for the test:	1) Prepare for the test:

Suchen




**ASTRO BOD FAST
ASTRO SIT FAST**

CANYON GUIDE

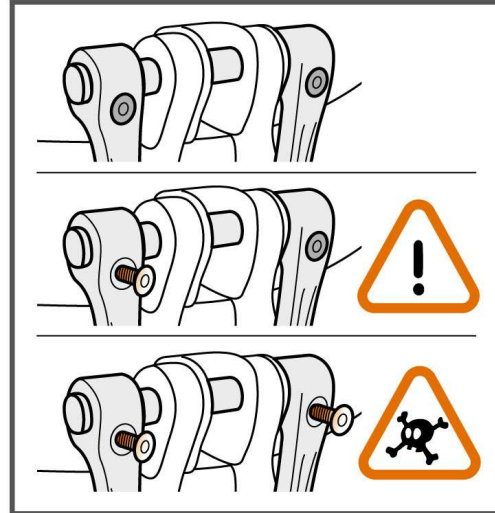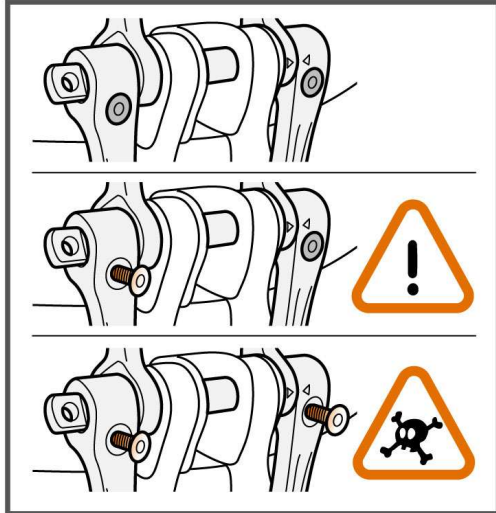

- Remove any accessories mounted in the shackle connection holes.

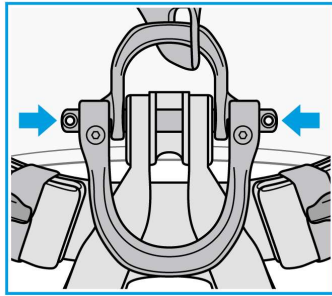


2) Perform the test below:


2) Perform the test below:



The pin does not slide:

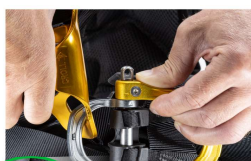

The pin slides out completely:

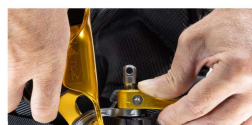

The pin does not slide:



The pin slides out completely:



Suchen



✔ Compliant result

✘ Non-compliant result

✔ Compliant result

✘ Non-compliant result

3) Test assessment:

A) ✔ Compliant result

1. Your product is not affected by this defect.
2. Fill in the form below to enable us to follow the progress of this request for inspection:

[Declaration form](#)

B) ✘ Non-compliant result

1. **Isolate the metal D.**
2. **Do not use this harness.**
3. **Quarantine it.**
4. Contact your local Petzl **after-sales service via the contact form**. Our after-sales service will then contact you with terms and conditions of care.


C) If you have any doubts about how to perform the test

Please contact your local after-sales service.

FAQ - Frequently Asked Questions

Where can I find the serial number of my harness?

The serial number is located on the plastic label inside the belt.

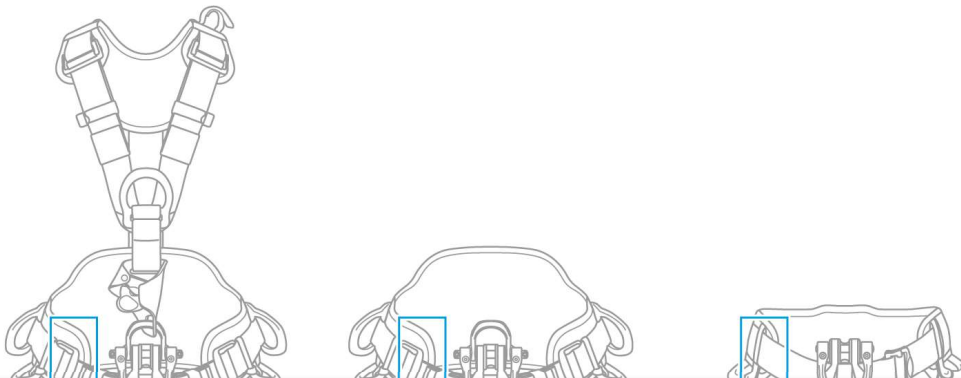

Suchen



Does this apply to all colors of metal D?

Yes.

Do I have to dismantle my gated ventral attachment point to perform this inspection?

No.

I have a lanyard installed on my harness. Do I have to dismantle it?

No.

Do I need to check that the screws are tightened to the correct torque?

No, for this inspection, torque has no impact.

I've never used my harness, do I need to inspect it?

Yes.

I'm already using my harness, do I need to inspect it?

Yes.

Is it necessary to apply high pressure on the pin to detect this defect?

No, just a little pressure is necessary.

During the test, the pin does not slide but I notice a slight play, is this normal?

Yes, this is a normal functional play.

Have there been any injuries with the products affected by this information?

To date, no injuries have been reported.

Newsletter abonnieren

und auf dem Laufenden bleiben

Email*

OK

Tritt der Community bei!



WER WIR SIND

Unsere Marke

Stiftung

Ausbildung

KONTAKT AUFNEHMEN

Petzl Deutschland

info.deutschland@petzl.com

+49 8847 698880

Kontaktformular

Suchen





@PETZLRUNNING



PETZL
NIGHT RUNNING

[Cookie-Einstellungen](#)

Die dargestellten Aktivitäten sind mit Risiken und Gefahren verbunden. Jeder Anwender muss eine Ausbildung absolviert haben und über entsprechende Kompetenzen in der Benutzung der Ausrüstung bei diesen Aktivitäten verfügen. Petzl Kontakt in Deutschland

© 1995-2023 Petzl

